



Service Bulletin

Bulletin No.: 20-NA-078

Date: April, 2020

TECHNICAL

Subject: Malfunction Indicator Lamp (MIL) Illuminated - DTC P0741 Set

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Express	2019	2019				MYC, MYD
	Silverado LD						
	Silverado 1500 (New Model)						
	Suburban						
	Tahoe						
GMC	Savana	2019	2019				MYC, MYD
	Sierra Limited						
	Sierra 1500 (New Model)						
	Yukon						

Involved Region or Country	North America
Condition	Some customers may comment that the MIL is illuminated. Some customers may also comment that the torque converter doesn't seem to lock up. Some technicians may find DTC P0741 (Torque Converter Clutch (TCC) System Stuck Off) set as an active or history code.
Cause	<div style="text-align: center;"> </div> <p style="text-align: right;">5448383</p> <p>This condition may be caused by the turbine shaft finish wearing out the turbine shaft bushing (218) and causing a pressure leak path for the T/C clutch apply. – The fit of the turbine shaft seal thru the bushing will have excessive clearance.</p>

Correction	If the fit of the bushing to turbine shaft is excessive the 4-5-6 clutch housing with turbine shaft and the pump cover with the turbine shaft bushing should be replaced.
-------------------	---

Service Procedure

Refer to *4-5-6 Clutch Overhaul* in SI.

Parts Information

Causal Part	Description	Part Number	Qty
X	HOUSING, 4-5-6 CLU	24237556	1
N/A	COVER KIT, A/ TRNS FLUID PUMP	24248573	
N/A	SEAL, T/CV FLUID (24237531	
N/A	Fluid, Transmission (DEXRON®VI)	88865601 (U.S.) 19367328 (Canada)	6-12.4 qts (5.7-11.7 liters)

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
8466430	4-5-6 Clutch Plate Replacement	Use the Published Labor Operations Time

Version	1
Modified	Released March 31, 2020

